


Atlanta Inbuilt

If the firebox is producing large banging noises on the heat up and the cool down, this is caused by the outer rear cabinet panel convexing out on heating up then returning back to position. This requires the rear panel to be held in the convex position.

Drill a 5mm hole in the rear of the firebox as shown, tap with a 6mm tap and fully wind in the 6m x 50 bolt provided.

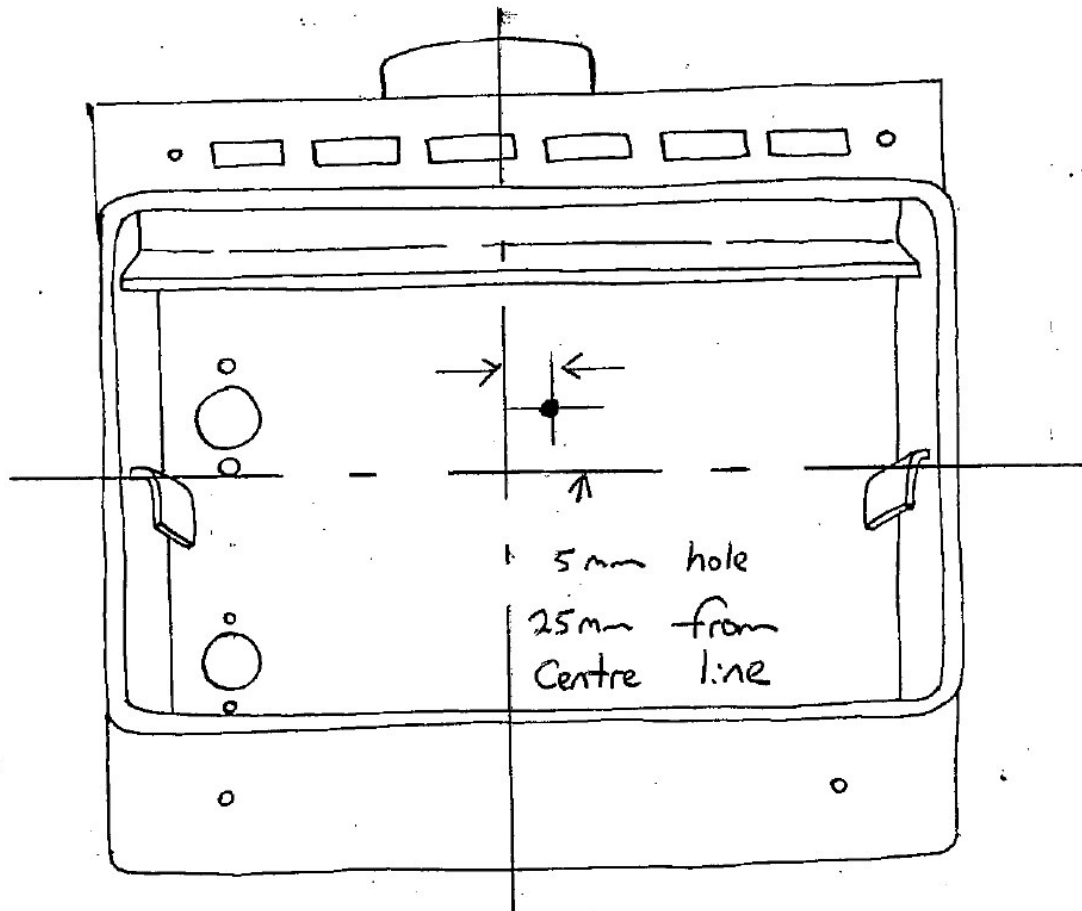

Drill 25mm from the centre to miss the rear ribs on the firebox at height just under the baffle.